

1234 Main Street WESLEY CHAPEL FL 33543-7862 Buyer Name 04/23/2025 9:00AM

#### 2.4.1 Eaves, Soffits & Fascia BENT SOFFIT

SILVA

- Recommendation

Left side of the structure (garage side), there is a section of vented soffit that is bent and out of place. Recommend replacing as needed

Recommendation Contact a qualified professional.



# 3.2.1 Exterior Doors EXTERIOR DOORS



- Front entry Door trim has cracking at joints on both right and left sides
- Front entry Door has holes that penetrate throguh the door. This may be due to the removal of a previous handle set and replacement with automated lock
- Front entry door is missing strike plate
- Rear exterior door from garage has missing strike plate and sticks while opening.
- Rear Glass slider (unlocked prior to inspection) left hand side (from interior) latching mechanism is loose

Recommend paint/patch repair as needed on trim

Recommend replacing door handle or mending hole in front entry as well as adding strike plate

Recommend adjusting rear garage door and adding proper strike plate


Recommend adjusting rear glass slider mechanism










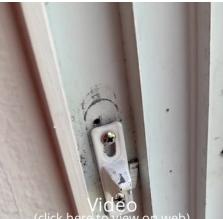





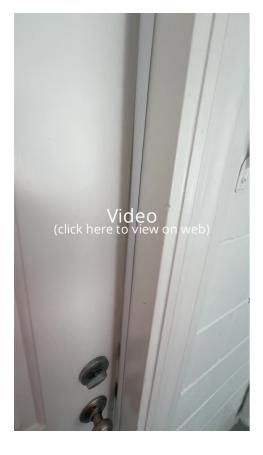

# 3.5.1 Vegetation, Grading, Drainage & Retaining Walls **SPRINKLER SYSTEM NOT FUNCTIONING**



Sprinkler system is a manual operated system attached to the right side exterior spigot.

This piping is leaking and as valves are turned on, only 1 sprinkler head operates.

Recommend repair by irrigation specialist.

Recommendation

Contact a qualified lawn care professional.





### 3.5.2 Vegetation, Grading, Drainage & Retaining Walls **WOODEN FENCE**

- Recommendation

Wood gate to the backyard is not installed properly. This fence drags when attempting to open as well as not aligned to close properly. Recommend qualified person assess and adjust as needed.

Recommendation Contact a qualified professional.



#### 5.2.1 Garage Door LIFT MOTOR DOES NOT FUNCTION



Garage door lift motor does not function at the time of inspection. When wall mount pressed, a loud knocking sound is heard and door does not lift or closed. Door manually lifts in place and does not appear to be locked prior to inspection

Recommend Garage Door specialist assess and repair as needed.

Recommendation

Contact a qualified garage door contractor.



5.4.1 Walls & Firewalls **CEILING** 

# Garage drywall ceiling have areas of cracking and seam tape cracking. Recommend patching/paint repairs as needed





6.3.1 Ventilation VENT COVER

- Recommendation

Guest bathroom vent cover is not in place. This appears to be a spring or snap in cover. Recommend adjusting to install.

Recommendation Contact a qualified professional.



# 6.4.1 Exhaust Systems BATHROOM VENTS INTO ATTIC



Primary Bathroom fan vents into the attic, which can cause moisture and mold. Recommend a qualified attic contractor property install exhaust fan to terminate to the exterior.




## 7.3.1 Branch Wiring Circuits, Breakers & Fuses **WIRE NOT TERMINATED**



There is a wire in the attic space that appears to originate from the panel (traverses to the panel top across garage space) that is not terminated and exposed. It is undetermined if this wire is live with inspector equipment. The opposite end is also near the attic access and undetermined if this jumps from a live box interior area.

Recommend Licensed electrical professional assess and remove/terminate as needed.

Recommendation Contact a qualified electrical contractor.

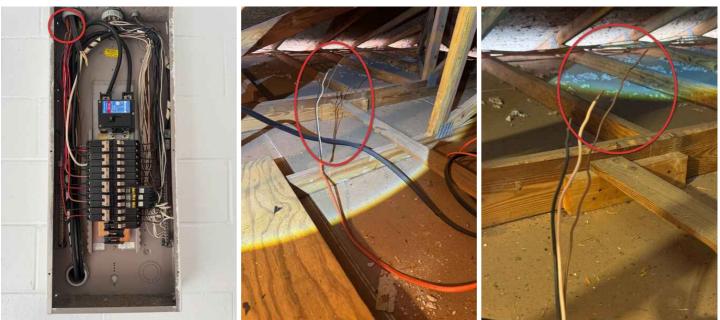

similar wire sheath in panel box. Undetermined if this is the same wire at the time of inspection.



Appears to originate from Panel area

## 7.3.2 Branch Wiring Circuits, Breakers & Fuses **EXTERIOR WIRE EXPOSED**



Rear patio light panel appears to be broken off and open and exposed. The wire is noted to be out of the broken fixture.

Recommend Licensed Electrical professional assess and repair as needed.

Recommendation Contact a qualified electrical contractor.



#### 7.5.1 GFCI & AFCI GFCI DOES NOT TEST/RESET



GFCI located in garage for the washing machine does not test/reset with either inspector tester or at push button (if applicable). Recommend Licensed Electrician assess and repair/replace.

Recommendation Contact a qualified electrical contractor.



# 9.1.1 Main Water Shut-off Device **EXTERIOR SPIGOTS**

- Recommendation

Exterior spigots in rear and front (garage side) leak at the handle when opened. Recommend adjusting the knob or consult plumber as needed.


Recommendation Contact a qualified professional.



9.3.1 Water Supply, Distribution Systems & Fixtures **KITCHEN FAUCET** 



Kitchen faucet is loose. Recommend tightening or adjusting the fixture as needed.

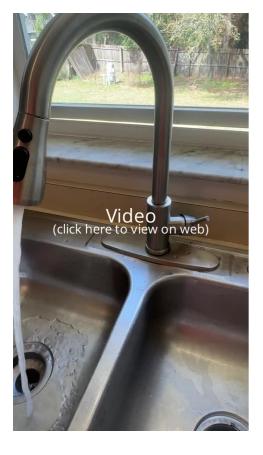

9.3.2 Water Supply, Distribution Systems & Fixtures **FLEX DRAIN** 



Primary sink drain appears to be a 1-1/4" strainer pipe to Flex drain. This is not properly installed as the strainer pipe is not secured and simply sitting in the pipe.

Furthermore, flex pipe is against code most jurisdiction for interior installation as these typically clog and can be displaced and shaped as materials are stored in the vanity.

Recommend installing proper PVP p-trap for drainage.

Recommendation

Contact a qualified plumbing contractor.



# 10.2.1 Doors INTERIOR DOORS

- Primary bedroom door is missing a henge in the middle
- Guest bathroom door sticks when open/closing and has a gap at the top
- Guest bathroom door does not have a doorstop and knob hits wall when opened

Recommend adjusting doors to close properly and install proper henge on Primary entry door. Install doorstop to prevent wall damage

Recommendation Contact a qualified professional.



### 10.2.2 Doors SHOWER DOOR

- Recommendation

Primary shower door is loose and does not close properly. Recommend adjusting to fix.



10.3.1 Windows WINDOWS



- Kitchen window is stuck in position with open gap to exterior
- Front guest bedroom window has heavy condensation in the upper pane. This may indicate improper seal
- Front Double window for living room has seal that appears to be not in place. This can cause condensation to the window over time
- Rear bedroom window has a cracked PVC trim seal and also does not open/close
- All exterior windows are missing screens

Recommend Window specialist assess and repair as needed. Replace screens as well

#### Recommendation

Contact a qualified window repair/installation contractor.



















#### 10.4.1 Floors GAPS AND SPACING



Primary bathroom floor tile under the vanity is lower by approx. 1/4" with some gaps visible. This may be due to improper installation.

#### Recommend proper repair and installation

Recommendation Contact a qualified professional.





# 10.8.1 Countertops & Cabinets CABINET DOOR DOES NOT CLOSE



Kitchen upper cabinet door (right hand side of sink) does not close or stay shut. Recommend adjusting door to close properly.

